


OptiGun 2-A Automatic Gun — Complete, Body & Shaft

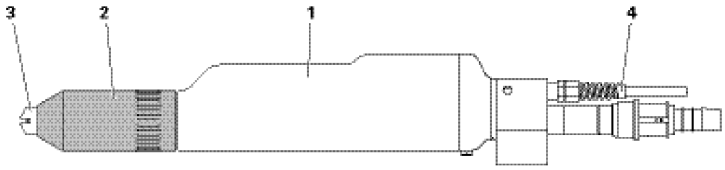

OptiGun 2-A — complete gun

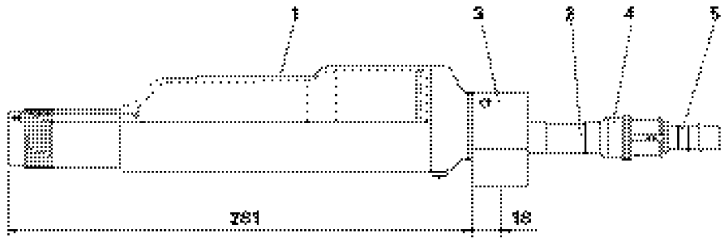

OptiGun 2-A — gun body

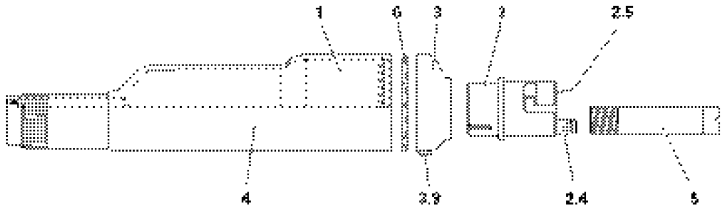

OptiGun 2-A — shaft

Complete gun

POS.	DESCRIPTION	POWDER PARTS #
—	OptiGun 2-A complete, negative polarity, incl. pos. 1–6	**P393568GX**
—	OptiGun 2-A complete, positive polarity, incl. pos. 1–6	*Call for availability*
1	Gun body OptiGun 2-A, complete, negative polarity	**P393649GX**
1	Gun body OptiGun 2-A, complete, positive polarity	*Call for availability*
2	Threaded sleeve	**P379166GX**
3	Flat jet nozzle — see Nozzle combinations (page 3)	
4	Gun cable, 20 m (65 ft), complete	**P393827GX**
5	Parts set (cable binder, screws, washer, quick coupling)	*Call for availability*
6	Cleaning brush, Ø 12 mm	*Call for availability*
7	Powder hose, Ø 16/11 mm (per ft)	*Call for availability*
8	Rinsing air hose, Ø 6/4 mm (per ft)	*Call for availability*

Gun body


POS.	DESCRIPTION	POWDER PARTS #
1	Shaft, complete, negative polarity (see Shaft)	**P393665GX**
1	Shaft, complete, positive polarity (see Shaft)	*Call for availability*
2	● Powder tube, complete	**P385182GX**
3	Gun mount (powder gun attachment)	**P382817GX**
4	Clamp sleeve	*Call for availability*
5	● Hose connection, complete	*Call for availability*
5.1	● O-ring for hose connection	*Call for availability*

Shaft


POS.	DESCRIPTION	POWDER PARTS #
1	Cascade, complete, negative polarity	**P1027321GX**
1	Cascade, complete, positive polarity	*Call for availability*
2	Adaptor, complete (incl. 2.4, 2.5)	**P385158GX**
2.4	Screw-in nipple, 1/8", Ø 6 mm	*Call for availability*
2.5	Plug cap, 1/8"	**P265560GX**
3	Adaptor piece, complete (incl. 3.3)	**P385069GX**
3.3	Pan head screw, M4 x 6 mm	**P267139GX**
4	Shaft (barrel) without cascade	**P393681GX**
5	Hollow screw	**P382680GX**
6	Gasket	**P382698GX**

● Wear part — keep on hand. Position numbers refer to the breakdown drawing. All parts are manufactured by or for Powder Parts, Inc., as "after market" replacement parts for powder coating equipment. The trademark names are owned by their respective companies and are used only for customer convenience.

OptiGun 2-AX Extended Automatic Gun & Gun Cables

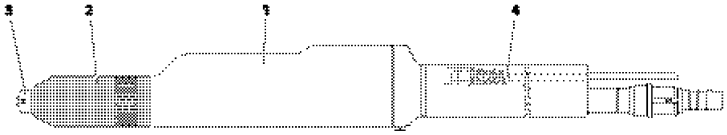

OptiGun 2-AX — complete gun

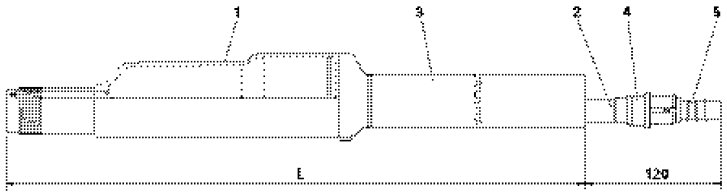

OptiGun 2-AX — gun body

Complete gun (negative polarity, incl. pos. 1–5)

POS.	DESCRIPTION	POWDER PARTS #
—	OptiGun 2-AX 1650 complete	**P393509GX**
—	OptiGun 2-AX 1450 complete	*Call for availability*
—	OptiGun 2-AX 1250 complete	**P393525GX**
—	OptiGun 2-AX 1050 complete	*Call for availability*
—	OptiGun 2-AX 850 complete	*Call for availability*
—	OptiGun 2-AX 650 complete	*Call for availability*
2	Threaded sleeve	**P379166GX**
3	Flat jet nozzle — see Nozzle combinations (page 3)	
4	Gun cable, 20 m (65 ft), complete	**P393827GX**
5	Parts set (cable binder, screw, quick coupling)	*Call for availability*

Gun body

LENGTH	GUN BODY (NEG.)	POWDER TUBE (2)	EXTENSION TUBE (3)
2-AX 1650 (L = 1646 mm)	*Call for availability*	**P385255GX**	*Call for availability*
2-AX 1450 (L = 1446 mm)	*Call for availability*	**P385344GX**	**P385441GX**
2-AX 1250 (L = 1246 mm)	*Call for availability*	**P385352GX**	**P385450GX**
2-AX 1050 (L = 1046 mm)	*Call for availability*	**P385360GX**	*Call for availability*
2-AX 850 (L = 846 mm)	*Call for availability*	**P385379GX**	*Call for availability*
2-AX 650 (L = 646 mm)	*Call for availability*	*Call for availability*	**P385484GX**


POS.	DESCRIPTION	POWDER PARTS #
1	Shaft, complete, negative polarity (see page 1)	**P393665GX**
4	Clamping part	*Call for availability*
5	● Hose connection, complete	*Call for availability*
5.1	● O-ring for hose connection	*Call for availability*

Gun cables


POS.	DESCRIPTION	POWDER PARTS #
	Gun cable, 11 m (36 ft), complete	**P393800GX**
	Gun cable, 15 m (49 ft), complete	**P393819GX**
	Gun cable, 20 m (65 ft), complete	**P393827GX**
	Extension cable, 5 m (16 ft)	*Call for availability*
	Extension cable, 10 m (33 ft)	*Call for availability*
	● O-ring, Ø 8.1 x 1.6 mm (cable plug)	**P263818GX**
	Cylinder screw, M5 x 6 mm (cable plug)	**P263907GX**

● Wear part — keep on hand. Position numbers refer to the breakdown drawing. All parts are manufactured by or for Powder Parts, Inc., as "after market" replacement parts for powder coating equipment. The trademark names are owned by their respective companies and are used only for customer convenience.

OptiGun 2-A(X) — Nozzle Combinations

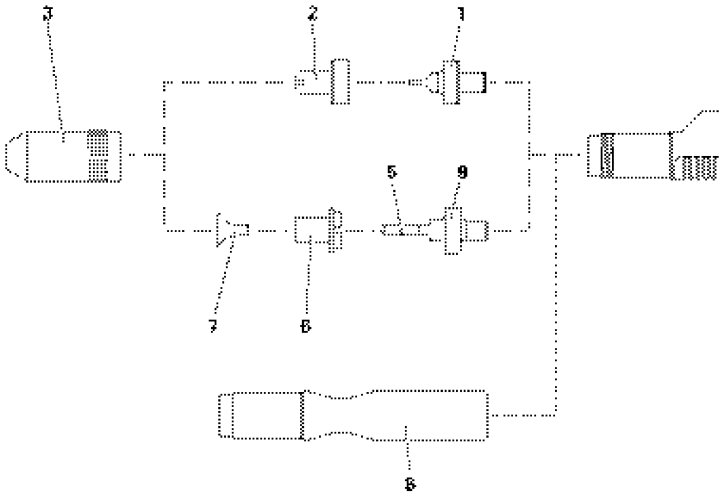

Nozzle combinations — NF08 flat jet / round jet

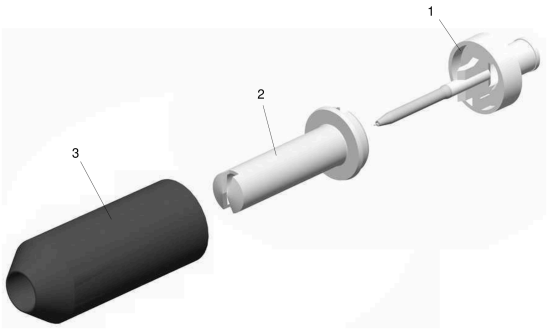

Nozzle combination — NF18-M

Nozzle combinations — NF08 (wear parts)

POS.	DESCRIPTION	POWDER PARTS #
1+2	● Flat jet nozzle set NF08 (nozzle + electrode holder)	**P1000047GX**
1	● Electrode holder, flat jet	**P1000055GX**
2	● Flat jet nozzle NF08, 15 mm	**P1000049GX**
3	Threaded sleeve	**P379166GX**
5+6+9	● Round jet nozzle set (nozzle, O-ring, electrode holder)	**P382922GX**
5	● O-ring, Ø 5 x 1 mm	*Call for availability*
6	● Round jet nozzle	**P378518GX**
7	● Deflector plate, Ø 16 mm	*Call for availability*
7.1	● Deflector plate, Ø 24 mm	*Call for availability*
7.2	● Deflector plate, Ø 32 mm	*Call for availability*
8	● Extension, 150 mm	**P378852GX**
8.1	● Extension, 300 mm	**P378860GX**
9	● Electrode holder, round jet (incl. 5)	**P382914GX**

Nozzle combination — NF18-M (wear parts)

POS.	DESCRIPTION	POWDER PARTS #
1+2	● Flat jet nozzle set NF18-M (nozzle + electrode holder)	*Call for availability*
1	● Electrode holder, flat jet NF18-M	**P1004529GX**
2	● Flat jet nozzle NF18-M	**P1004527GX**
3	Threaded sleeve	**P379166GX**

● Wear part — keep on hand. Position numbers refer to the breakdown drawing. All parts are manufactured by or for Powder Parts, Inc., as "after market" replacement parts for powder coating equipment. The trademark names are owned by their respective companies and are used only for customer convenience.